




D2008 100t/m

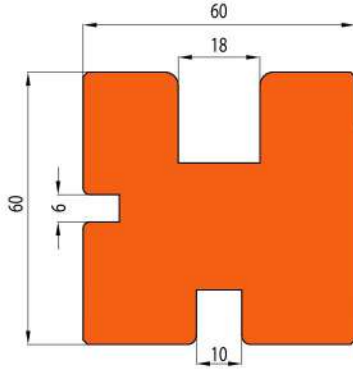


D2009 80t/m

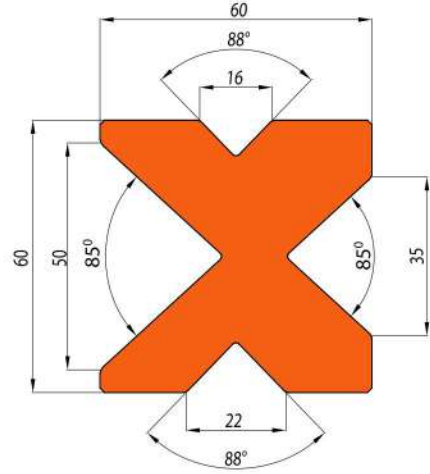

D2009/85 80t/m

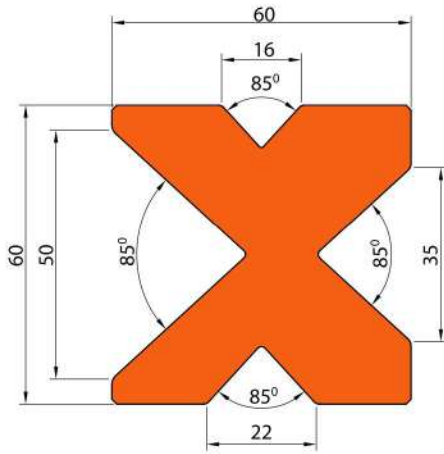


D2009/60 60t/m

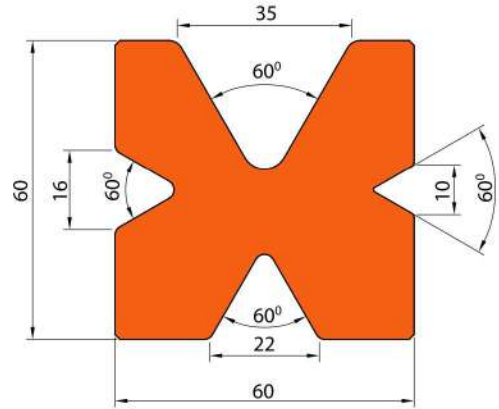


D2011/30/18 80t/m

$\alpha = 30^\circ$
 $V = 18\text{mm}$

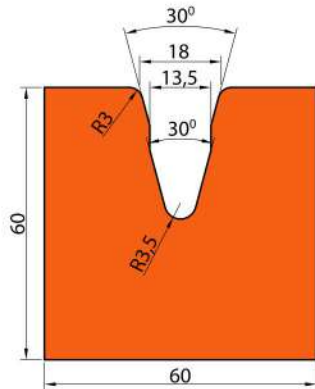


D2011/30/25 50t/m

$\alpha = 30^\circ$
 $V = 25\text{mm}$

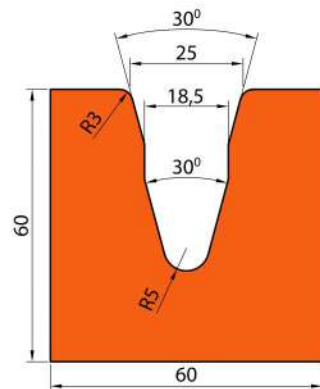


D2011/45/32 90t/m

$\alpha = 45^\circ$
V = 32mm

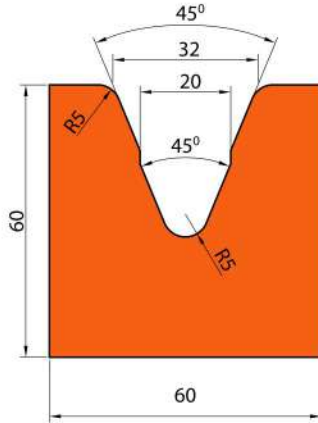


D2011/85/32 90t/m

$\alpha = 85^\circ$
V = 32mm

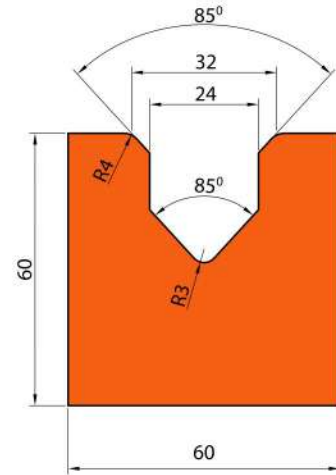


D2011/45/40 100t/m

$\alpha = 45^\circ$
V = 40mm

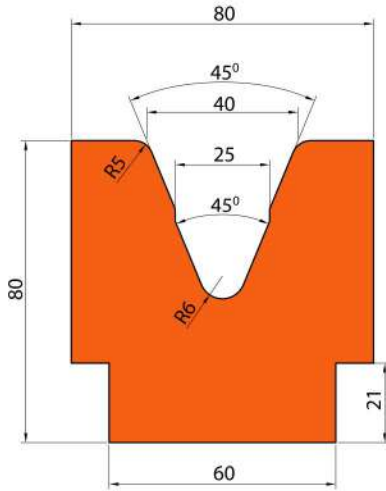


D2011/85/40 100t/m

$\alpha = 85^\circ$
V = 40mm

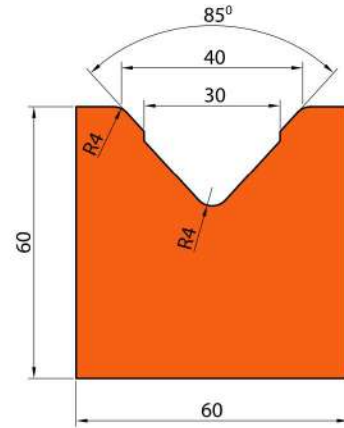


D2011/60/50 100t/m

$\alpha = 60^\circ$
V = 50mm

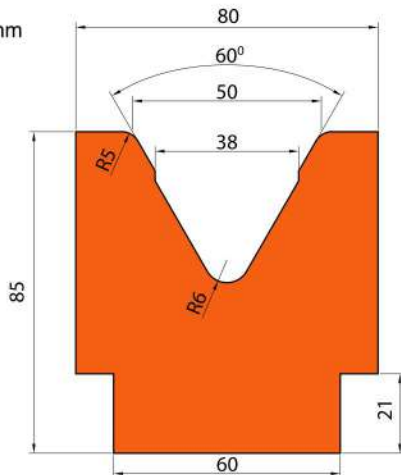


D2011/85/50 100t/m

$\alpha = 85^\circ$
V = 50mm

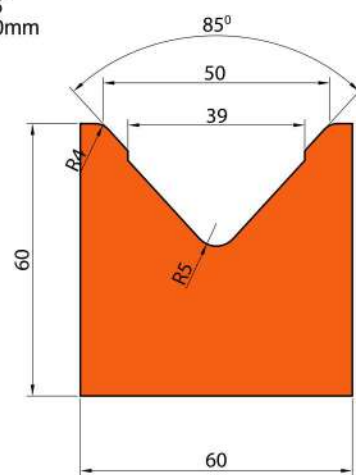


D2011/60/63 100t/m

$\alpha = 60^\circ$
V= 63mm

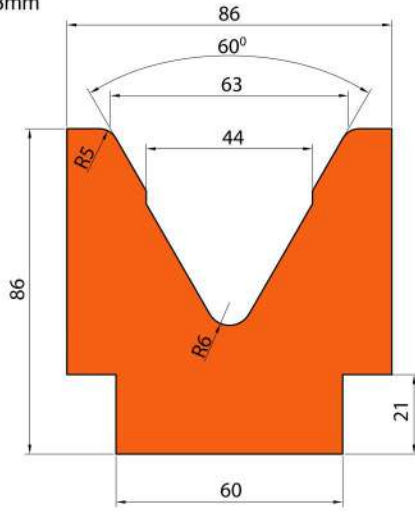


D2011/85/63 100t/m

$\alpha = 85^\circ$
V= 63mm

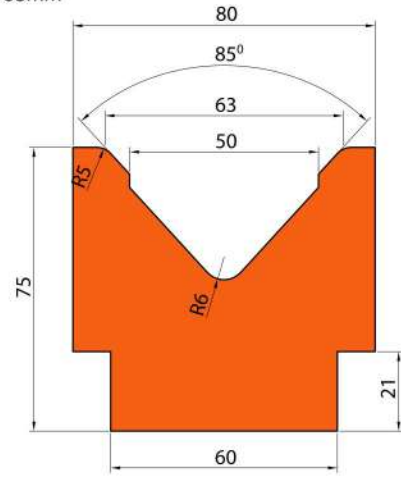


D2011/85/80 100t/m

$\alpha = 85^\circ$
V= 80mm

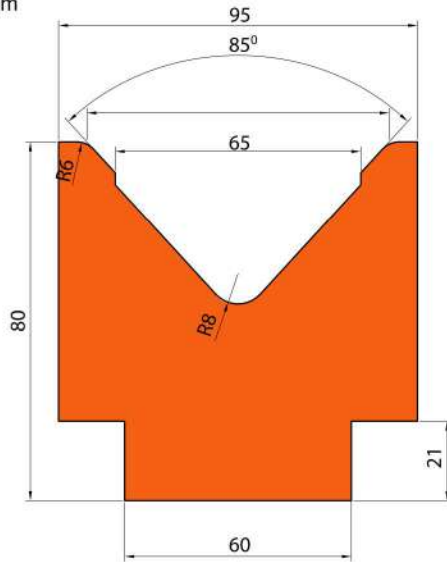


D2011/85/100 100t/m

$\alpha = 85^\circ$
V= 100mm

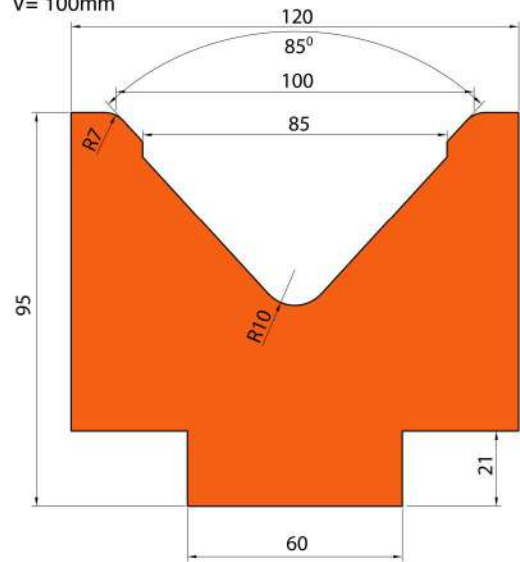


D2011/80/125 70t/m

$\alpha = 80^\circ$
V= 125 mm

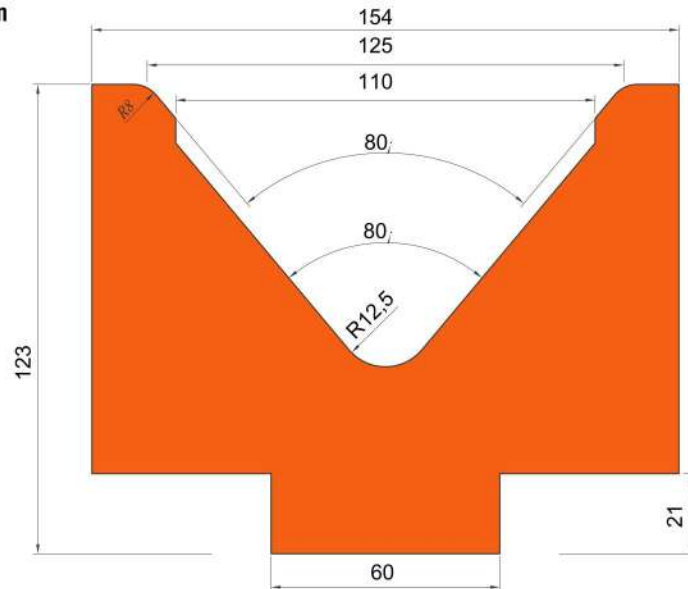

D2030

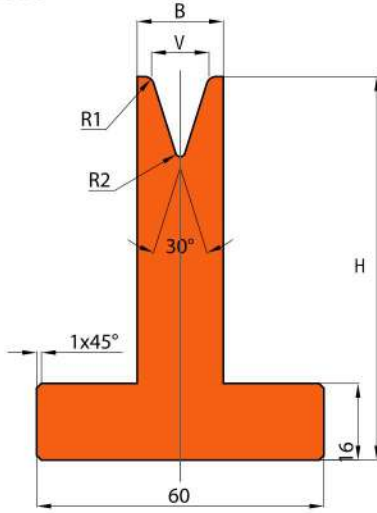

D2030/6 30t/m

$\alpha = 30^\circ$
 $V = 6\text{mm}$, $B = 14\text{mm}$
 $R1 = 0,6\text{mm}$, $R2 = 0,6\text{mm}$
 $H = 80\text{mm}$, 120mm

D2030/8 30t/m

$\alpha = 30^\circ$
 $V = 8\text{mm}$, $B = 18\text{mm}$
 $R1 = 1\text{mm}$, $R2 = 1\text{mm}$
 $H = 80\text{mm}$, 120mm

D2030/10 35t/m

$\alpha = 30^\circ$
 $V = 10\text{mm}$, $B = 24\text{mm}$
 $R1 = 1\text{mm}$, $R2 = 1\text{mm}$
 $H = 80\text{mm}$, 120mm

D2030/12 35t/m

$\alpha = 30^\circ$
 $V = 12\text{mm}$, $B = 24\text{mm}$
 $R1 = 1\text{mm}$, $R2 = 1\text{mm}$
 $H = 80\text{mm}$, 120mm


D2030/16 35t/m

$\alpha = 30^\circ$
 $V = 16\text{mm}$, $B = 30\text{mm}$
 $R1 = 2\text{mm}$, $R2 = 2\text{mm}$
 $H = 80\text{mm}$, 120mm

D2030/20 35t/m

$\alpha = 30^\circ$
 $V = 20\text{mm}$, $B = 35\text{mm}$
 $R1 = 2,5\text{mm}$, $R2 = 3\text{mm}$
 $H = 80\text{mm}$, 120mm

D2045

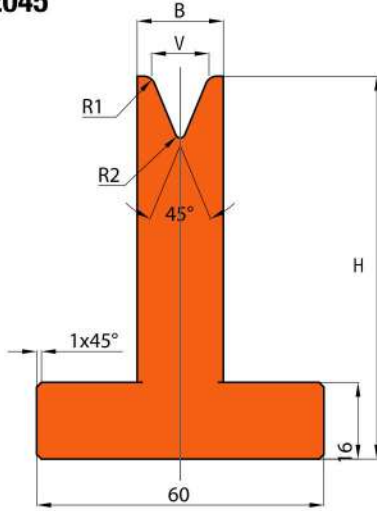


D2045/10 50t/m

$\alpha = 45^\circ$
 $V = 10\text{mm}$, $B = 18\text{mm}$
 $R1 = 2\text{mm}$, $R2 = 1\text{mm}$
 $H = 80\text{mm}$, 120mm

D2045/12 50t/m

$\alpha = 45^\circ$
 $V = 12\text{mm}$, $B = 24\text{mm}$
 $R1 = 2,5\text{mm}$, $R2 = 1\text{mm}$
 $H = 80\text{mm}$, 120mm

D2060

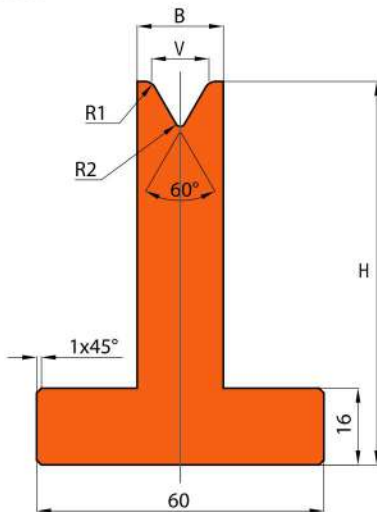

D2060/8 60t/m

$\alpha = 60^\circ$
 $V = 8\text{mm}$, $B = 14\text{mm}$
 $R1 = 1,5\text{mm}$, $R2 = 0,8\text{mm}$
 $H = 80\text{mm}$, 120mm

D2060/10 60t/m

$\alpha = 60^\circ$
 $V = 10\text{mm}$, $B = 16\text{mm}$
 $R1 = 2\text{mm}$, $R2 = 1\text{mm}$
 $H = 80\text{mm}$, 120mm

D2060/12 60t/m

$\alpha = 60^\circ$
 $V = 12\text{mm}$, $B = 18\text{mm}$
 $R1 = 2,5\text{mm}$, $R2 = 1\text{mm}$
 $H = 80\text{mm}$, 120mm

D2060/16 60t/m


$\alpha = 60^\circ$
 $V = 16\text{mm}$, $B = 24\text{mm}$
 $R1 = 1,5\text{mm}$, $R2 = 1,5\text{mm}$
 $H = 80\text{mm}$, 120mm

D2060/20 60t/m

$\alpha = 60^\circ$
 $V = 20\text{mm}$, $B = 30\text{mm}$
 $R1 = 2\text{mm}$, $R2 = 2\text{mm}$
 $H = 80\text{mm}$, 120mm

D2060/25 60t/m

$\alpha = 60^\circ$
 $V = 25\text{mm}$, $B = 40\text{mm}$
 $R1 = 3\text{mm}$, $R2 = 3\text{mm}$
 $H = 80\text{mm}$, 120mm

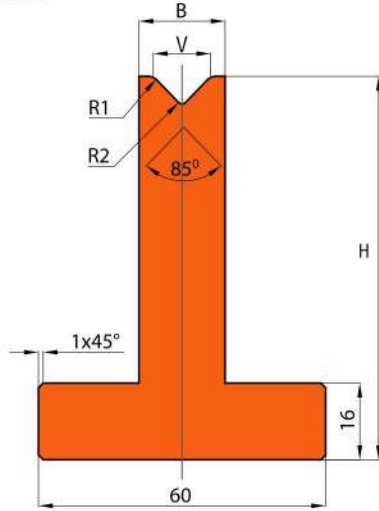D2085**D2085/6 100t/m** $\alpha = 85^\circ$

V= 6mm, B=12mm

R1= 1.5mm, R2= 0.5mm

H= 80mm, 120mm

D2085/8 100t/m $\alpha = 85^\circ$

V= 8mm, B=14mm

R1= 1mm, R2= 0.5mm

H= 80mm, 120mm

D2085/10 100t/m $\alpha = 85^\circ$

V= 10mm, B= 16mm

R1= 1mm, R2=1mm

H= 80mm, 120mm

D2085/12 100t/m $\alpha = 85^\circ$

V= 12mm, B=18mm

R1= 2.5mm, R2= 1mm

H= 80mm, 120mm

D2085/16 100t/m $\alpha = 85^\circ$

V= 16mm, B= 22mm

R1= 2.5mm, R2= 1mm

H= 80mm, 120mm

D2085/20 100t/m $\alpha = 85^\circ$

V= 20mm, B= 30mm

R1= 3mm, R2= 3mm

H= 80mm, 120mm

D2085/25 100t/m $\alpha = 85^\circ$



V= 25mm, B=40mm

R1= 3mm, R2= 3mm

H= 80mm, 120mm


D3000 100t/m

A= 8mm, 10mm, 12mm

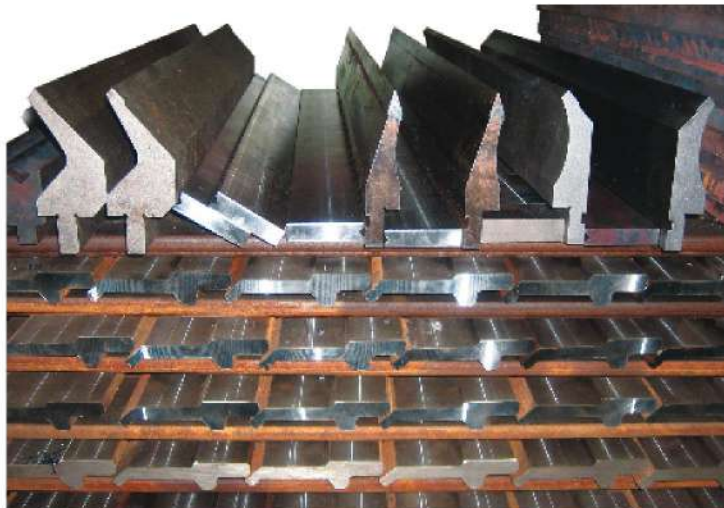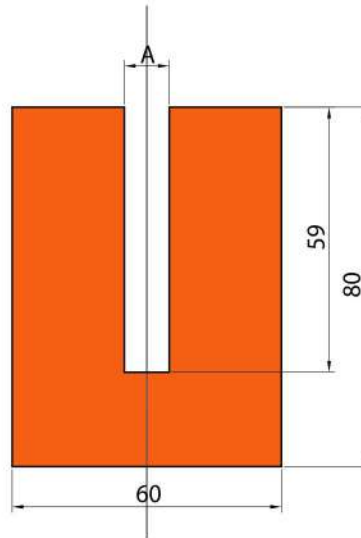


D3001/30/6 60t/m

$\alpha = 30^\circ$
V= 6mm

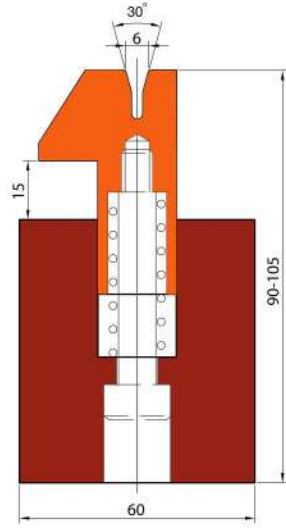


D3001/30/8 100t/m

$\alpha = 30^\circ$
V= 8mm

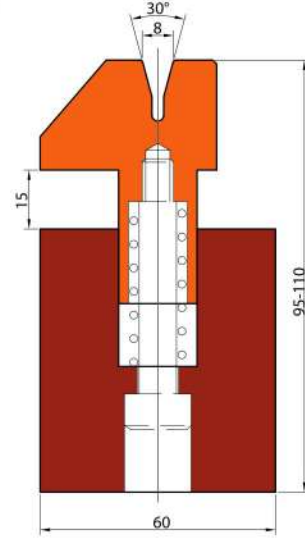


D3001/26/10 100t/m

$\alpha = 26^\circ$
V= 10mm

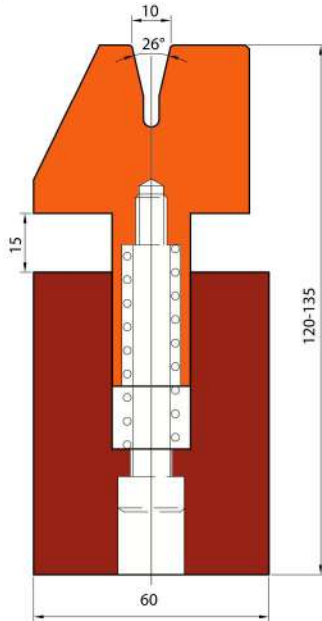


D3001/26/12 100t/m


$\alpha = 26^\circ$
V= 12mm

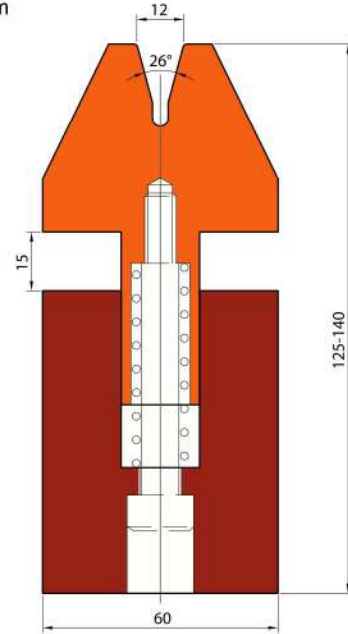


D4014 100t/m

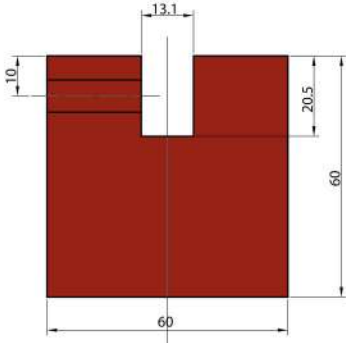

D4015 100t/m

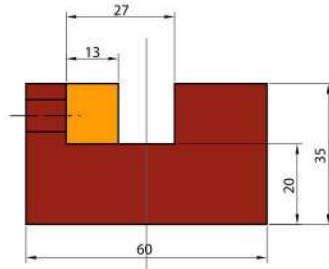


D4016 100t/m

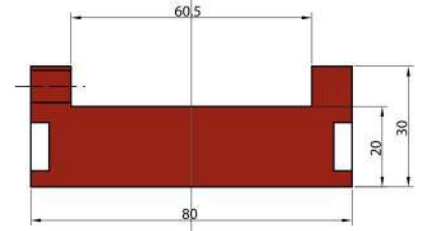


INT 1

L= 150mm
H= 100mm, 150mm

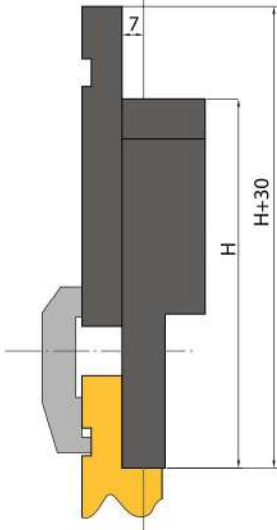


INT 2

L= 150mm
H= 120mm

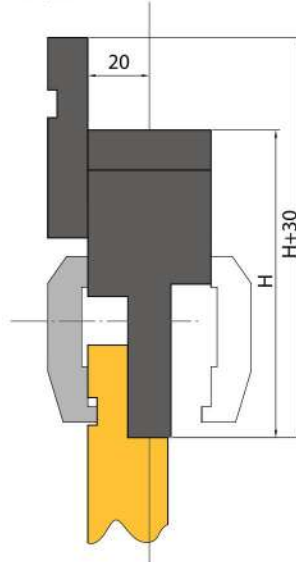


INT 3

L= 150mm
H= 100mm

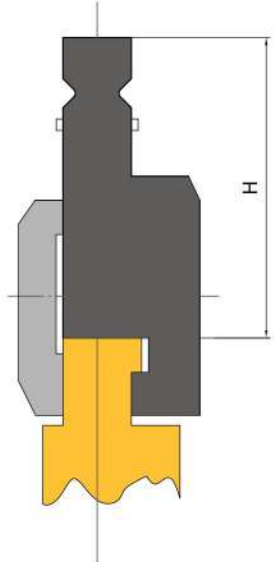


INT 4

L= 150mm
H= 100mm

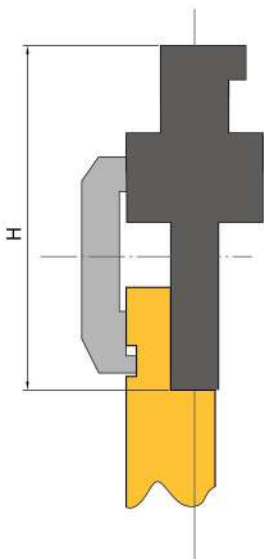


INT 5

L= 150mm
H= 100mm

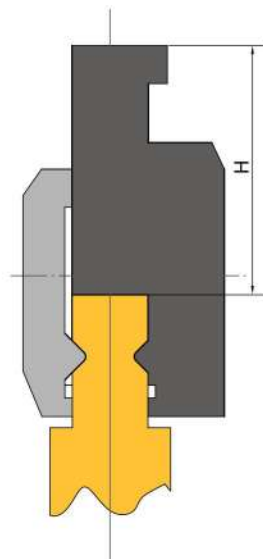

INT/A

L= 150mm
H= 50mm

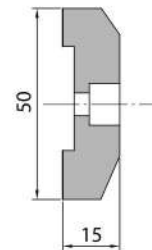

INT/S

L= 150mm
H= 58mm

